

WELL ABANDONMENT REPORT

This form is to be submitted as an Intent to Abandon whenever an abandonment is planned on a borehole. After the abandonment is complete, this form shall again be submitted as a Subsequent Report of the actual work completed. The approved intent shall be valid for six months after the approval date, after that period, a new intent will be required. Attachments required with the Intent to Abandon are wellbore diagrams of the current configuration and the proposed configuration with plugs set.
A Subsequent Report of Abandonment shall indicate the actual work completed. Attachments required with a Subsequent Report are a wellbore diagram showing plugs that were set and casing remaining in the hole, the job summaries from all plugging contractors used, including wireline and cementing (third party verification) and any logs that may have been run during abandonment.

OGCC Operator Number: 47120 Contact Name: CHERYL LIGHT
 Name of Operator: KERR MCGEE OIL & GAS ONSHORE LP Phone: (720) 929-6461
 Address: P O BOX 173779 Fax: (720) 929-7461
 City: DENVER State: CO Zip: 80217- Email: cheryl.light@anadarko.com

For "Intent" 24 hour notice required, Name: Gomez, Jason Tel: (970) 573-1277
 Email: jason.gomez@state.co.us

COGCC contact:

API Number 05-123-26899-00 Well Name: TALLGRASS Well Number: 10-17
 Location: QtrQtr: SESE Section: 17 Township: 1N Range: 68W Meridian: 6
 County: WELD Federal, Indian or State Lease Number: _____
 Field Name: WATTENBERG Field Number: 90750

Notice of Intent to Abandon Subsequent Report of Abandonment

Only Complete the Following Background Information for Intent to Abandon

Latitude: 40.046826 Longitude: -105.022901
 GPS Data:
 Date of Measurement: 07/13/2009 PDOP Reading: 2.6 GPS Instrument Operator's Name: RENEE DOIRON
 Reason for Abandonment: Dry Production Sub-economic Mechanical Problems
 Other _____
 Casing to be pulled: Yes No Estimated Depth: 700
 Fish in Hole: Yes No If yes, explain details below
 Wellbore has Uncemented Casing leaks: Yes No If yes, explain details below
 Details: _____

Current and Previously Abandoned Zones

Formation	Perf. Top	Perf. Btm	Abandoned Date	Method of Isolation	Plug Depth
CODELL	7994	8014			
NIOBRARA	7591	7862			
Total: 2 zone(s)					

Casing History

Casing Type	Size of Hole	Size of Casing	Weight Per Foot	Setting Depth	Sacks Cement	Cement Bot	Cement Top	Status
SURF	12+1/4	8+5/8	24	973	770	973	0	VISU
1ST	7+7/8	4+1/2	11.6	8,158	1,005	8,158	1,440	CBL

Plugging Procedure for Intent and Subsequent Report

CIBP #1: Depth 7540 with 25 sacks cmt on top. CIBP #2: Depth 4530 with 2 sacks cmt on top.
CIBP #3: Depth 80 with 25 sacks cmt on top. CIBP #4: Depth _____ with _____ sacks cmt on top.
CIBP #5: Depth _____ with _____ sacks cmt on top.

NOTE: Two(2) sacks cement required on all CIBPs.

Set 25 sks cmt from 7540 ft. to 7140 ft. Plug Type: CASING Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:
Set _____ sks cmt from _____ ft. to _____ ft. Plug Type: _____ Plug Tagged:

Perforate and squeeze at 1285 ft. with 20 sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth
Perforate and squeeze at _____ ft. with _____ sacks. Leave at least 100 ft. in casing _____ CICR Depth

(Cast Iron Cement Retainer Depth)

Set 110 sacks half in. half out surface casing from 1255 ft. to 650 ft. Plug Tagged:

Set 25 sacks at surface

Cut four feet below ground level, weld on plate Above Ground Dry-Hole Marker: Yes No

Set _____ sacks in rat hole Set _____ sacks in mouse hole

Additional Plugging Information for Subsequent Report Only

Casing Recovered: _____ ft. _____ inch casing Plugging Date: _____
of _____

*Wireline Contractor: _____ *Cementing Contractor: _____

Type of Cement and Additives Used: _____

Flowline/Pipeline has been abandoned per Rule 1103 Yes No *ATTACH JOB SUMMARY

Technical Detail/Comments:

I hereby certify all statements made in this form are, to the best of my knowledge, true, correct, and complete.

Signed: _____ Print Name: CHERYL LIGHT

Title: SR REGULATORY ANALYST Date: 10/3/2017 Email: CHERYL.LIGHT@ANADARKO.COM

Based on the information provided herein, this Well Abandonment Report (Form 6) complies with COGCC Rules and applicable orders and is hereby approved.

COGCC Approved: McCoy, Diane Date: 2/5/2018

CONDITIONS OF APPROVAL, IF ANY: _____

Expiration Date: 8/4/2018

COA Type	Description
	1) Provide 48 hour notice of plugging MIRU via electronic Form 42. 2) Properly abandon all flowlines as per Rule 1103. File electronic Form 42 once abandonment complete. 3) Operator shall implement measures to control unnecessary and excessive venting, to protect the health and safety of the public, and to ensure that vapors and odors from well plugging operations do not constitute a nuisance or hazard to public welfare. 4) After pumping plug across section of casing that is milled, shut down and wait on cement at minimum 8 hours; verify gas migration has been eliminated. If evidence of gas migration or pressure remains contact COGCC Engineer for an update to plugging orders. Tag this plug. Leave at least 100' of cement in the wellbore for each plug.
	Prior to starting plugging operations a bradenhead test shall be performed. 1) If, before opening the bradenhead valve, the beginning pressure is greater than 25 psi, sampling is required. 2) If pressure remains at the conclusion of the test, or if any liquids were present during the test, sampling is required. The Form 17 shall be submitted within 10 days of the test. Sampling shall comply with Operator Guidance - Bradenhead Testing and Reporting Instructions. If samples are collected, copies of all final laboratory analytical results shall be provided to the COGCC within three (3) months of collecting the samples.

Attachment Check List

Att Doc Num	Name
401419191	WELL ABANDONMENT REPORT (INTENT)
401419194	PROPOSED PLUGGING PROCEDURE
401419195	WELLBORE DIAGRAM
401535306	FORM 6 INTENT SUBMITTED

Total Attach: 4 Files

General Comments

User Group	Comment	Comment Date
Engineer	Operator will mill a section of casing from 1285-1265', this was input into the perforate and squeeze section on this form.	02/05/2018
Engineer	on hold, emailed operator- Plugging does not address bradenhead issues. Also, need better shoe plug, looks like a squeeze or pulling casing deeper may be possible.	01/30/2018
Public Room	Document verification complete 10/04/17	10/04/2017

Total: 3 comment(s)